

# SPECIFICATION NO: RD571

NEW WORK/REPAINT:	REPAINT – INTERIOR / EXTERIOR									
SUBSTRATE:	Fibreglass									
PAINT FINISH:	Plascon Super Universal Enamel`` PRODUCT CODE: <b>NY 1/G</b> (Smooth Finish – Solvent Based, superior high gloss enamel)									
COLOUR:	White plus Plascon colour system and other fan decks.									
ENVIRONMENT:	The Maintenance Cycle is a guide but can vary due to micro climate changes identified on the site which will affect the longevity of the coating system									
	As per ISO 12944-2:1998		Maintenance	Cycle (Yea	ırs)					
			Int	Ext						
	C1 -	Inland	5	3						
	C3 -	Industrial	5	3						
	C5 -	Coastal / Marine	5	3						

Plascon Coating System	Application Method	Spreading Rate m²/ℓ	WFT/DFT μm (min & max)	Reducer/ Cleaner	Overcoating time h @ 23 °C	Technical Data Sheet No	TVOC g/୧
Spot Primer Plascon Epiwash Strontium Chromate Primer (AW 255/KAT 508) Mixing ratio 1:1 by volume	B or S	@ 25 μm Theo: 9.6 Prac: 5.1	WFT 83-125 DFT 20-30	GP Epoxy Reducer (EPT 1) Or Epiwash Thinner (TH 128)	4 2 weeks max	AW 255	618
1 <sup>st</sup> Finishing Coat Plascon Super Universal Enamel (NY 1/G/TSE)	B, R or S	@ 30 μm Theo: 16.3 Prac: 9	WFT 51-71 DFT 25-35	Min. Turps (AZH 1)	16	NY 1/G	381 white <415 tint bases
2 <sup>nd</sup> Finishing Coat Plascon Super Universal Enamel (NY 1/G/TSE)	B, R or S	@ 30 μm Theo: 16.3 Prac: 9	WFT 51-71 DFT 25-35	Min. Turps (AZH 1)	16	NY 1/G	381 white <415 tint bases





### SPECIFICATION NO: RD571

### SURFACE PREPARATION:

NB: FOR HEALTH REASONS AVOID AIR BORNE DUST WHEN PREPARING FIBRE GLASS SURFACES. AIR BORNE FIBRES ARE DETRIMENTAL TO THE ENVIRONMENT AND TO HUMAN HEALTH. KEEP SURFACES DAMP DURING PREPARATION.

- A Remove all loose and flaking paint by scraping or other suitable means. Feather edges carefully and remove dust using a damp cloth.
- Wash surfaces using Aquasolv Degreaser (GR 1) to remove any oil, grease and other contaminants. A water break-free surface must be achieved.
- ^ Rinse thoroughly with fresh water and allow complete drying.
- Abrade surface with 120 grit paper to provide a key. Dust off.
- Surfaces must be clean and dry before painting.

### **APPLICATION:**

#### Spot Primer

Mix base and hardener thoroughly in a 1:1 ratio by volume before use.

 Spot prime bare and repaired areas with Plascon Epiwash Strontium Chromate Primer (AW 255). Allow minimum 4 hours to dry.

#### **Finishing Coats**

 Apply two full coats of Plascon Super Universal Enamel (NY 1/G/TSE) to achieve complete obliteration, allowing 16 hours drying between coats.

NB: if white is used, three coats might be necessary to achieve obliteration.

## TABLE REFERENCES:

- Technical Data Sheet (TDS): User must always ensure that latest issue is used.
- B = Brush (ready for use), R = Roller (synthetic, min. 10mm pile) (ready for use), S = Airless spray (ready for use).
- Theoretical spreading rate quoted is for smooth non-porous substrates and does not include allowance for surface profile, porosity, wastage and uneven film application. Suitable allowance should be made according to type of work, method and skill of applicator. Practical spreading rate quoted is an average guide only - actual must be determined by user.
- Overcoating times are at 23 °C and 75 % relative humidity. Longer times must be allowed under cooler and moist conditions. DO NOT paint during inclement weather and when temperature is below 10 °C.
- Fading and chalking will occur to a greater or lesser degree depending on pigmentation and generic binder type.
- NB: Life expectancy may vary, depending on environmental conditions and stresses, within the macro/micro climate of the project.

Copyright @Kansai Plascon (Pty) Ltd 2013. All rights reserved. No part of this work may in any form or by any means be reproduced without prior written permission of the copyright owner. PLASCON is the registered trade mark of Kansai Plascon (Pty) Ltd,

